



SERVICE BULLETIN

Citizens Radio
#CB-75
May 7, 1973

PUBLISHED BY THE JOHNSON COMPANY, INC., SECA, MINNESOTA 55092

EQUIPMENT AFFECTED

Messenger 122
Part No. 242-0122-xxx

REASON FOR REVISION

Some units have been shipped with an 8.2K ohm resistor installed for R29. The symptom to look for in these units is--the squelch does not open within specifications when at maximum (tight) squelch.

REVISION

Replace resistor R29 with a 1K ohm resistor.

PARTS REQUIRED

<u>QTY</u>	<u>PART NUMBER</u>	<u>PART DESCRIPTION</u>
1	569-1504-102	1.0K Ω \pm 10%, 1/2 W

CHANGE ACTION

Make this change as required.