



EQUIPMENT AFFECTED

Messenger 124, Part No. 242-0124-001
Messenger 124-M, Part No. 242-0134-001
Messenger 320, Part No. 242-0320-001
Messenger 323, Part No. 242-0153-001

REASON FOR REVISION

To prevent self-modulation due to the inadequate grounding of C70.

REVISION

Solder a jumper wire from the positive [redacted] of C70 at the heatsink to ground using an available hole in the printed circuit board.

CHANGE ACTION

Make this change as required. Current production models have a taptite screw in place of the nut and bolt holding the heatsink to the board.