

SUBJECT: Citizen's Band

MODEL: 14T300/301

DATE: April 20, 1977

FIELD BULLETIN #77-004

RCA

TO: ALL CB/SCANNER WARRANTY REPAIR CENTERS

SUBJECT: SERVICE MANUAL CORRECTIONS

A series of corrections has been made in the service manual for the 14T300/301; you will receive copies of the updated version. The more important changes are listed below:

1. Page 8, concerning PLL alignment:

a) 10.2392 MHz \pm 0.13 KHz.

b) 37.6592 MHz \pm 0.38 KHz.

c) 10.6942 MHz \pm 0.12 KHz.


2. Page 9, concerning RF meter adjustment:

a) Adjust RV104 so that the meter pointer indicates 3.8 watts output, the same as the wattmeter in step C.g.

3. In the parts list, page 17:

R109 is a 68K ohm resistor.

There are other changes that are minor in nature that are of interest, but will not influence your servicing procedures.

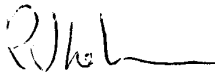

R. J. Nelson, Manager
Field Quality Assurance
RJN/1kr